


RCA

Radiola 33 (D. C.) 220 VOLTS

SERVICE NOTES

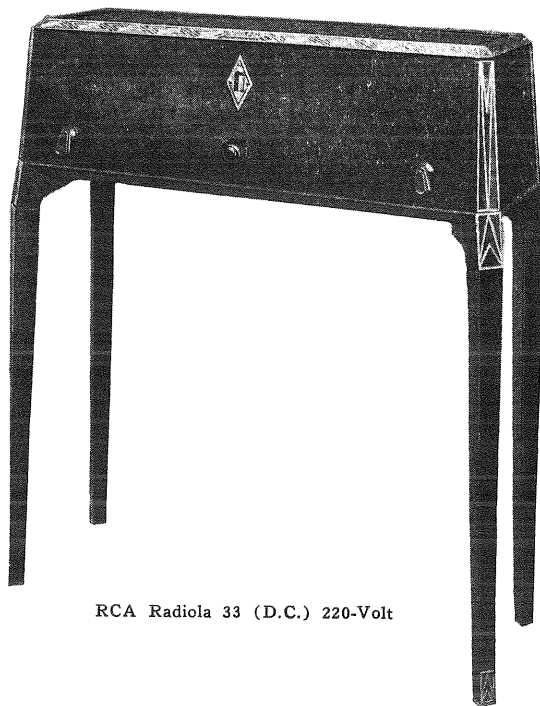

RCA Radiola 33 (D.C.) 220-Volt

[First Edition—1M
Copyright Jan., 1930]

RCA-VICTOR COMPANY, INC.

FOREIGN DEPARTMENT

233 BROADWAY, NEW YORK CITY

PREFACE

Service goes hand in hand with sales. The well-informed RCA-Victor Authorized Dealer renders service at time of sale in affording information as to proper installation and upkeep. Subsequent service and repair may be required by reason of wear and tear and mishandling, to the end that RCA-Victor Loudspeaker and Radiola owners may be entirely satisfied.

Obviously, this service can best be rendered by properly equipped service organizations having a thoroughly trained personnel with a knowledge of the design and operation of RCA-Victor Loudspeakers and Radiolas.

Such service organizations have been established by RCA-Victor Distributors, and Authorized Dealers are advised to refer any major work or replacement to their selected Distributors. Minor replacements and mechanical and electrical adjustments may be undertaken by the RCA-Victor Dealer.

To assist in promoting this phase of the Dealer and Distributor's business the RCA-Victor Service Department has prepared a series of Service Notes—of which this booklet is a part—containing technical information and practical helps in servicing Loudspeakers and Radiolas.

This information has been compiled from experience with Dealers and Distributors' service problems and presents the best practice in dealing with them. A careful reading of these Service Notes will establish their value, and it is suggested they be preserved for ready reference.

In addition to supplying the Service Notes, the RCA-Victor Service Department maintains a corps of engineers who are qualified to render valuable help in solving service problems. These engineers call upon the trade at frequent intervals to advise and assist Distributors in the performance of service work.

Property of RCA-Victor Company, Inc. Confidential and to be used only by its Authorized Distributors and Dealers furnishing service in connection with its apparatus.

Copyright 1930—RCA-Victor Company, Inc.

CONTENTS

	Page
Preface	2
Electrical Specifications	5
Physical Dimensions	5
Introduction	5

PART I—GENERAL SERVICE DATA

Circuit Characteristics	5	Adjustment of R.F. Compensating Condensers	8
Antenna (Outdoor and Indoor Type).....	6	Alignment of Tuning Condensers.....	9
Ground	7	Pilot Lamp	11
Radiotrons	7	Interstage Transformers, Output Transformers and Filter Condenser.....	11
Line Voltage Regulating Switch.....	7	Service Data Chart.....	12
Radiola 33 Wave Trap.....	7		

PART II—ELECTRICAL TESTS

Voltage Readings	14	Testing Condensers and Testing for Defective- ly Grounded Parts.....	21
Voltage Supply System.....	15	Resistance Tests	21
Radiola 33 (D.C.) 220-volt Continuity Tests...	15		

PART III—MAKING REPLACEMENTS

Removing the Receiver and S.P.U. Chassis from the Cabinet	22	Replacing the Tuning Dial.....	23
Replacing the Radio Frequency Coils.....	22	Replacing Filament or UX-171A Biasing Re- sistors	23
Replacing Radiotron Sockets.....	22	Replacing the Voltage Regulating Switch.....	23
Replacing Main Tuning Condensers and Drive	23	Replacing the Output Transformer.....	23
Replacing Condenser Drive Cable.....	23	Replacing the Receiver By-Pass Condenser Pack	23

LIST OF ILLUSTRATIONS

Front View of Radiola 33 (D.C.) 220 volts...	1	Radiotron Socket Layout Showing Filament Plate and Grid Terminals	14
Top View of Receiver Chassis and Socket Power Unit	4	Schematic Circuit Diagram of Voltage Supply System	15
Sub-Chassis View of Receiver and Socket Power Unit	4	Continuity Wiring Diagram of Receiver.....	16
Radiotron Sequence	6	Continuity Wiring Diagram of S.P.U.....	18
Schematic Circuit Diagram of Receiver and Socket Power Unit.....	8	Removing Receiver Chassis and Socket Power Unit From Cabinet in One Operation.....	21
Adjusting R.F. Compensating Condenser.....	10	Gang Tuning Condenser Drive Mechanism and Cable	23
Aligning Tool	11		

RADIOLA 33 (D.C.) 220-VOLT

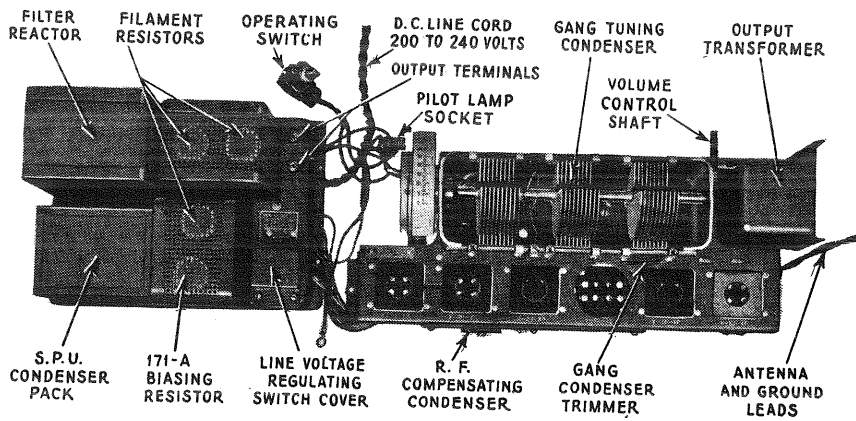


Figure 1—Top view of the receiver chassis and socket power unit

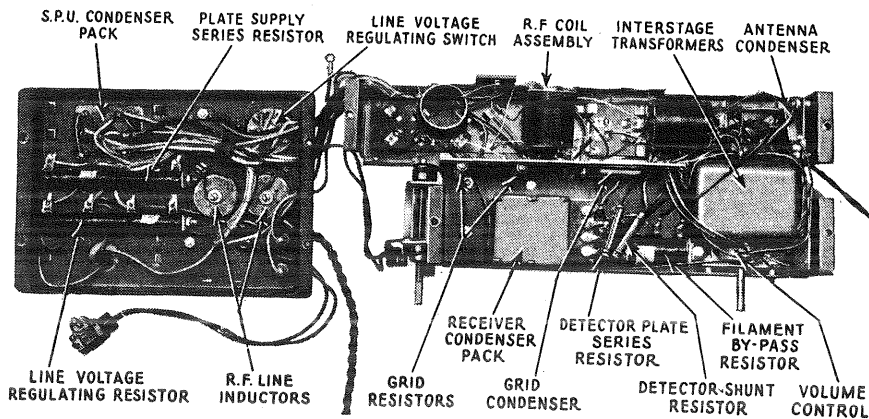


Figure 2—Sub-chassis view of receiver assembly and socket power unit